

SANDEL

SERVICE BULLETIN SB 3308-02

Date: August 3, 2000

Explanation: Regulator failures have been reported after installation of replacement lamp at normal replacement interval using Lamp Kit SPN 90122. Failure is related to stamped code on component L4.

This mandatory SB requires verification of code stamp on component L4 and appropriate action as described below.

Applicability: Serial numbers 1900-2013 inclusive.

Also the following individual serial numbers:
1050,1058,1065,1075,1081,1083,1095,1104,
1109,1121,1123,1124,1125,1128,1134,1136,1139,1142,
1145,1146,1200,1202,1216,1231,1244,1247,1248,
1249,1252,1256,1262,1263,1270,1274,1275,1277,1301,
1310,1342,1351,1369,1374,1375,1376,1377,1378,
1379,1380,1381,1382,1383,1385,1386,1387,1389,1390,
1392,1393,1394,1395,1398,1399,1413,1519,1520,1534,
1576,1626,1630,1714,1716,1717,1729,1741,1743,1757,
1764,1772,1774,1775,1782,1811,1817,1820,1821,
1830,1832,1836,1858,1861,1863

Compliance: Units which have had no lamp replacements shall comply at the next scheduled lamp replacement.

If the lamp replacement has already been accomplished using kit SPN 90122 this inspection shall be performed immediately.

Warranty: Inspections performed during normal lamp replacement interval are not covered under warranty as minimal additional time is required. for inspection.

Units requiring removal, inspection and re-installation separate from lamp replacement will be authorized for 1.5 hour labor. For units returned to factory for repair Sandel will pay for return freight on our account (US only).

Scheduling: Call 760-727-4900 to schedule. An RMA number will be issued which must be visible on the exterior of the shipping box.

SANDEL

Approval: This does not affect the original approval.

Tools: Inspection mirror

Instructions:

1. Follow the disassembly instructions in the SN3308 Lamp Replacement Kit or SN-3308 Installation Manual. After removal of the top cover, perform the following steps.
2. Refer to attached photograph for position of affected component (L4).
3. This component will be stamped “100” or “3R3”. Visually confirm the stamped code. A partial identification (i.e. using one or more of the 3 characters) is acceptable if the stamped code is not fully in view.
4. If the stamped code is determined to be “3R3”, perform the balance of the normal lamp replacement (if required) and return the unit to service.
5. If the stamped code contains a “1” or “0” or the code cannot be verified, the unit must be **returned** to Sandel for repair.

Testing: Perform normal ground checkout procedures on the SN3308 after re-installation per Sandel SN3308 installation manual 90106-IM, applicable revision.

END TEXT

SANDEL



LOCATION OF
COMPONENT L4